



90726

1643074
1780140



DAF
CF 85 / XF / XF 105
ALL MODELS 360 - 510 HP
10 / 2005-

PROBLEM PREMATURE OIL COOLER FAILURE, INTERNAL BURST > LEAKAGES

OIL PRESSURE RELIEF VALVE FAILURE > LEADS TO EXCESSIVE LUBRICANT PRESSURE AND OIL COOLER DAMAGE

BACKGROUND Oil pressure relief valve withing the oil filter/oil cooler assembly makes sure that the delivered lubricant pressure is consistent regardless of the engine speed. It protects the system against overpressure. Malfunctions of the valve is one of the major reasons for oil pressure issues within the system. Its moving elements need very precise clearance or they can get stuck, thus causing failure in the flow control.

Especially, the oil cooler/filter assembly installed close to the pump outlet can suffer from damage provoked by overpressure.


RECOMMENDED SOLUTION The pressure relief valve may wear out over time but typically its failure is premature and consequential to other problems. To avoid the valve getting stuck, thus leading to the lubrication system's critical failure, some prevention and regular service are recommended:



- Replace oil and oil filter regularly and according to the vehicle's maintenance schedule.
- Ensure that the lubrication system is clean.
- With an oil cooler failure or/and replacement, make sure to measure the pressure of the lubricant in the system
- **Control the condition of the pressure relief valve, clean and replace it whenever a failure is suspected. The previous oil cooler damage may have its root cause in the valve failure.**

Pressure Relief Valve location in the vehicle oil filter/oil cooler assembly. OE 1725348

OE PART 164 30 79

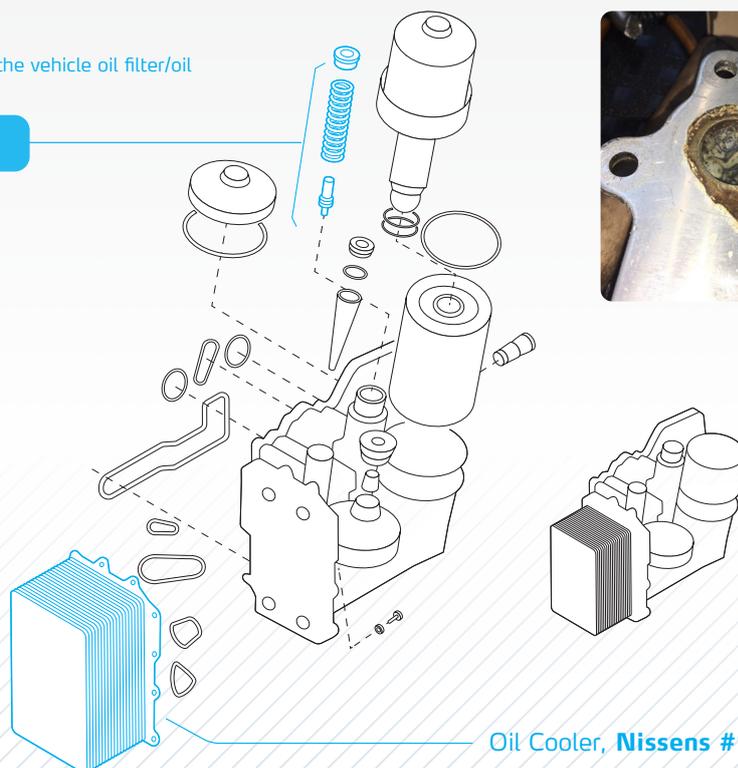

Lubricant mixed with coolant, seen on the oil cooler outlets. One of the most common outcomes of lubricant overpressure and internal bursting of the oil cooler.

Oil Cooler, Nissens #90726



The material and its contents are provided without warranty of any kind, and by publishing it, we disclaim any liability. Always follow the given vehicle manufacturer's instructions to comply with the right service and maintenance procedures. Nissens Automotive A/S shall not be held responsible for any property damage or personal injury, direct or indirect damage, due to failure or down time in vehicle operation caused by incorrect application, installation and/or abuse of our products.

©Nissens Automotive A/S, Ormhøjgårdvej 9, 8700 Horsens, Denmark. For further technical and contact information visit www.nissens.com

Nissens
Training
Concept



Nissens
DELIVERING THE DIFFERENCE